



# SERVICE BULLETIN NO. 16

SEC. VIII, DIV. A  
SERVICE BULLETINS  
ISSUED SEPTEMBER, 1963

\*\*\*\*\*

## SERVICE BULLETIN NO. 16

A Field Fix has been designed to eliminate a surging condition found on some Vertical Shaft engines.

A replacement Throttle Shaft & Lever Assembly, Part No. 6-441-500, which incorporates a Roll Pin to stabilize the Governor during the entire operating range should be used in place of 6-108-500. This Shaft & Lever is used on the following:

ENGINE SERIES	CARBURETOR USED
401 - 405 - 417 - 407 411 - 415	39-123-500
497 - 499	39-122-500
407 - 415	39-566-500
401 - 405 - 417	39-747-500
407 - 415	39-788-500

Proper Spring installation (as illustrated) is important.

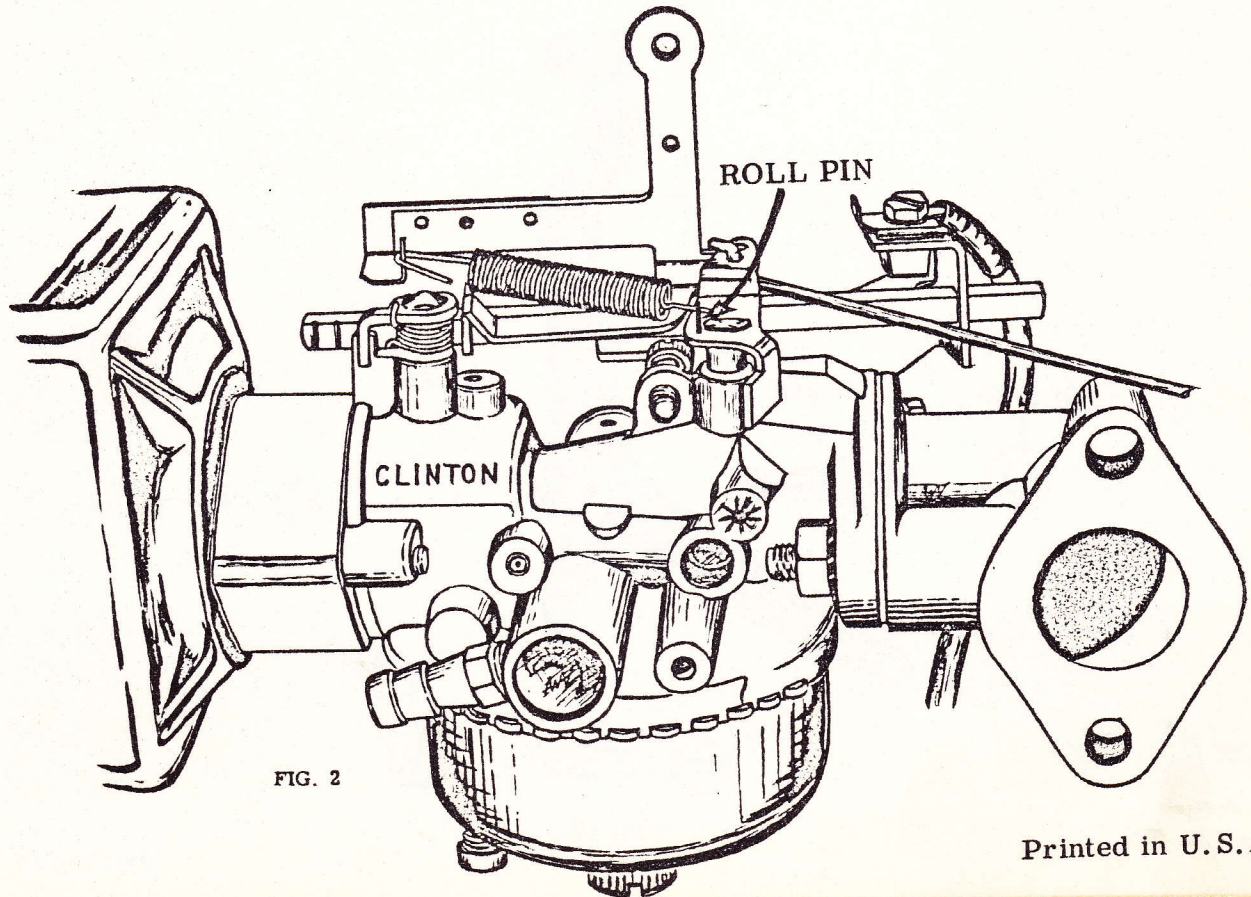


FIG. 2